


# PRESA DI PRESSIONE JIC-NPTF / GAS CILINDRICO JIC-NPTF / BSPP GAUGE FITTINGS



## FF1 FF

Femmina - Femmina (presa pressione)  
Double Female (gauge fitting)


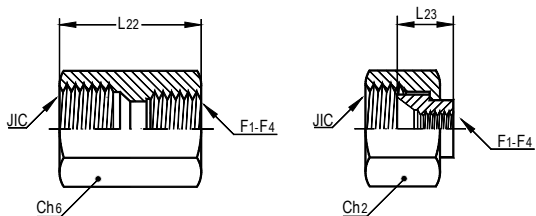


Codice NPTF NPTF Code	Codice BSPP BSPP Code	∅ est. tubo Tube O.D.	JIC	F1 (NPTF) F4 (BSPP)	Ch2	Ch6	L22	L23
FF1-06-1/4	FF-06-1/4	6	7/16"-20	1/4"	-	19	28,5	-
FF1-08-1/4	FF-08-1/4	8	1/2"-20	1/4"	-	19	28,5	-
FF1-10-1/4	FF-10-1/4	10	9/16"-18	1/4"	-	19	29	-
FF1-12-1/4	FF-12-1/4	12	3/4"-16	1/4"	-	22	32	-
FF1-16-1/4	FF-16-1/4	14÷16	7/8"-14	1/4"	-	27	37	-
FF1-20-1/4	FF-20-1/4	18-20	1.1/16"-12	1/4"	32	-	-	18
FF1-25-1/4	FF-25-1/4	25	1.5/16"-12	1/4"	41	-	-	20
FF1-30-1/4	FF-30-1/4	30-32	1.5/8"-12	1/4"	50	-	-	21
FF1-38-1/4	FF-38-1/4	38	1.7/8"-12	1/4"	60	-	-	25

## RACCORDI A SALDARE JIC WELDABLE JIC FITTINGS

### CFS CFSX

Curva a Saldare  
Elbow Butt Weld Pipe End

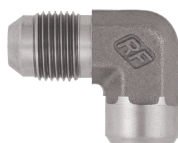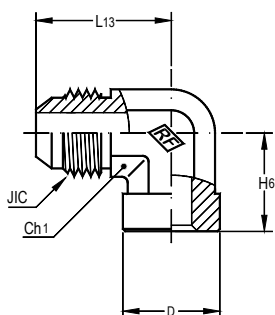



X = Speciale (corta)  
X = Special (short)

Codice Code	∅ est. tubo Tube O.D.	JIC	Ch1	D	H6	L13
CFS-08	8	1/2"-20	14	15	22,5	31
CFS-10	10	9/16"-18	14	15	22,5	31
CFS-12	12	3/4"-16	19	20	26	36
CFS-16	14÷16	7/8"-14	22	23	31	41,5
CFS-20	18-20	1.1/16"-12	27	28	34,5	48
CFS-25	25	1.5/16"-12	33	34	41	55

Codice Code	∅ est. tubo Tube O.D.	JIC	Ch1	D	H6	L13
CFSX-08	8	1/2"-20	14	15	16	27
CFSX-10	10	9/16"-18	14	15	16	27
CFSX-12	12	3/4"-16	19	20	18	31,5
CFSX-16	14÷16	7/8"-14	22	23	20	36,5
CFSX-20	18-20	1.1/16"-12	27	28	30	42
CFSX-25	25	1.5/16"-12	33	34	26	46

### JMS

Maschio a Saldare  
Male Socket Weld Tube End

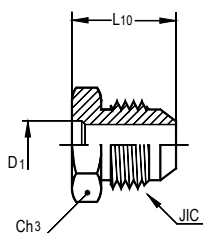

Codice Code	∅ est. tubo Tube O.D.	JIC	Ch3	D1	L10
JMS-08-08	8	1/2"-20	14	8	24,5
JMS-10-10	10	9/16"-18	19	10	25,5
JMS-12-12	12	3/4"-16	22	12	28
JMS-16-16	14÷16	7/8"-14	24	16	32
JMS-20-20	18-20	1.1/16"-12	27	20	40
JMS-25-25	25	1.5/16"-12	36	25	42